


CONDITION OF CONCERN

On Mazdaspeed6 and RX-8 vehicles, improper installation of the fuel pump mounting rings may lead to cracking of the rings, causing fuel leakage. In addition, on RX-8 vehicles, due to insufficient heat resistance at the top side of the fuel tank, the fuel pump mounting rings may deteriorate due to heat exposure from the engine and exhaust pipe which may also lead to cracking of the rings, causing fuel leakage. Fuel leakage may result in increased risk of fire in the presence of an ignition source near the vehicle.


OUTLINE OF REPAIR

New fuel pump mounting rings will be installed on Mazdaspeed6 and RX-8 vehicles. In addition, thermal insulation pad will be added to the fuel tank on RX-8 vehicles.

Please refer to the Repair Procedure document on MGSS for further details.

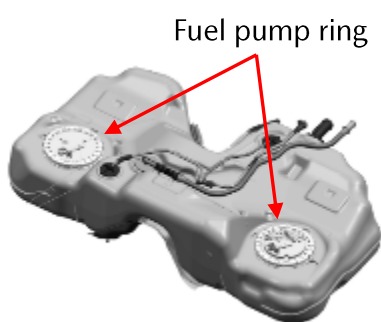

Fuel Tank (Mazdaspeed6)

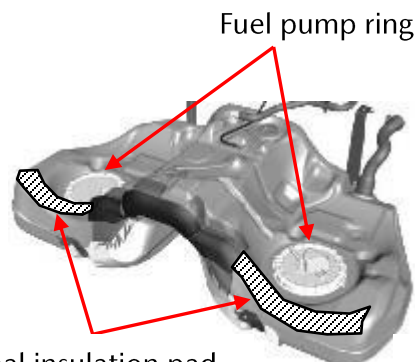

Thermal insulation pad

Fuel Tank (RX-8)

SUBJECT VEHICLES

Model	Subject VIN range	Subject production date range
2006-2007 Mazdaspeed6	JM1 GG**** 61 100056 – 108051 JM1 GG**** 71 108052 – 110746	From August 4, 2005 through June 30, 2007
2009-2011 RX-8	JM1 FE**** 90 400031 – 403405 JM1 FE**** A0 403406 – 404868 JM1 FE**** B0 404869 – 405726	From March 11, 2008 through May 16, 2011

The asterisk symbol “*” can be any letter or number.

OWNER NOTIFICATION

Mazda will notify U.S. owners by first class mail no later than November 20, 2021.

PARTS INFORMATION

Description	Part Number	Quantity	Applicable model	Note
Fuel Pump Ring Set	G3YA-42-A1X	1	Mazdaspeed6	Components: Fuel pump ring (2 pcs) Retainer (2 pcs) Packing (2 pcs)
	F1Y0-42-A1X	1	RX-8	Components: Fuel pump ring (2 pcs) Retainer (2 pcs) Packing (2 pcs) Pad (2 pcs)
Campaign Label	9999-95-065A-06	1=50 labels	--	Obtain in Mazda e-Store (no charge)
Vehicle Emission Recall Proof of Correction Certificate *	9999-95-ERPC-99	1=50 certificates	--	



* California Department of Motor Vehicles and the Commonwealth of Massachusetts, in conjunction with the California Air Resources Board and the Environmental Protection Agency for the State of Massachusetts, have implemented the Registration Renewal/Recall Tie-In Program, which requires the completion of Emission Recalls prior to registration renewal. Mazda dealers must provide customers a **Vehicle Emission Recall – Proof of Correction Certificate** (p/n 9999-95-ERPC-99) upon completion of the recall.

WARRANTY CLAIM PROCESSING INFORMATION

For Mazdaspeed6 vehicles:

	Fuel pump rings replacement
Process Number	AM034A
Symptom Code	99
Damage Code	99
Causal Part Number & Quantity	G3YA-42-A1X & 1
Labor Operation Number & Labor Hours	XXT73ARX & 1.3 hrs. (Fuel is not drained)
	XXT73BRX & 1.6 hrs. (Fuel is drained from Half level)
	XXT73CRX & 1.8 hrs. (Fuel is drained from Full level)

For RX-8 vehicles:

	Fuel pump rings replacement Thermal insulation pads installation
Process Number	AM034A
Symptom Code	99
Damage Code	99
Causal Part Number & Quantity	F1Y0-42-A1X & 1
Labor Operation Code & Labor Hours	XXT72ARX & 0.9 hrs. (Fuel is not drained)
	XXT72BRX & 1.2 hrs. (Fuel is drained from Half level)
	XXT72CRX & 1.4 hrs. (Fuel is drained from Full level)

RENTAL CAR INFORMATION

Mazda recommends the usage of the MCVP loaner vehicle when available. If all MCVP loaner vehicles are in use and unavailable, and the customer needs a rental car, then use your local rental facility and offer a rental car. Be sure that every effort is made to repair the car within one business day or less, so the next customer can receive the same experience.

Rental Car Warranty Claim Information

	MCVP Vehicle Preferred	Rental Agency Vehicle
Warranty Type Code	N/A MCVP does not require claim submission	A
Symptom Code		99
Damage Code		99
Part Number Main Cause		5555-51-21IR
Part Quantity		0
Labor Operation Code		MM024XRX
Labor Hours		0
Sublet – Rental Car		
Sublet Invoice Number		Number from Rental Invoice or Dealer Purchase Order
Sublet Type Code		Enter "Z9" (other)
Sublet Amount		Up to \$30.00 per day for the number of days customer had rental car
Sublet Text		Number of days rental car was supplied to customer

Rental expenses exceeding the two-day limit will require prior Warranty Department Authorization, as outlined in the Mazda Rental Car Reimbursement Program policy.